Summary of Preliminary Assessment on Structural, Fire and Electrical Safety

Name of the Factory : Astro Stich Art Ltd.

Address of the Factory : Ward # 6, Block # B, Sharifpur-Wazerpara Main Road,

Sharifur, National University, Gazipur-1704

Present Status of the Factory : Under Operation

Structural Assessment Conducted by : BUET

Date of Structural Inspection : 2013-12-06

Fire & Electrical Assessment Conducted by : BUET

Date of Fire & Electrical Inspection : 2014-01-23

BASIC INFORMATION:

Astro Stitch is located at ground floor of a six story building. The following information was noted:

i. Building Usage Type : Garments Factory.

ii. Structural System : RC beam column frame structure

iii. Floor System : Edge supported RC solid floor slab system on RC beam.

iv. Floor Area : Approx. 13,000 sq ft/floor

v. No. of Stories : Six

vi. Construction Year : Completed in the year 2009 (constructed in one phase).

vii. Foundation Type : Individual footing 13 ft below previous G.L. (as per structural

drawing)

viii. Design Drawings : Available (Engr. Md. Abul Bashar, MIEB-6418).

ix. Soil Investigation Report : Available (B.D.C. Soil & Foundation Engineers, 542-Barotek

Adarsha Nagar, Middle Badda, Dhaka).

x. Construction Materials : stone aggregates, 72.5 grade rebar. (60 grade was used in

calculation)

xi. Generator : Located inside the building.

RECOMMENDATIONS FOR CORRECTIVE ACTION:

The recommendations of corrective action for both Structural and Fire & Electrical Safety comprises in Short Term, Mid Term and Long Term basis.

The recommendations for **Structural Safety** corrective action are:

Short Term (Immediate) : The authority of the factory should supply a load plan to be vetted.

Mid Term (6-weeks) : None
Long Term (6-months) : None

The recommendations for **Fire & Electrical Safety** corrective action are:

(A): Recommendations for Fire Safety corrective actions:

Immediate	
(the factory should not continue to be occupied until these non-conformities have been rectified):	

Astro Stich Art Ltd. Last update on Page 1

Summary of Preliminary Assessment on Structural, Fire and Electrical Safety

Short Term Remove all temporary obstructions from all escape routes, aisles and passageways. (Actions that must be incorporated Ensure minimum width of corridors, passageways and into a Fire Safety Management Plan immediately (a week) and should be a aisles. regular activity Ensure adequate numbers of fire drills. Ensure easy access to portable extinguishers and monitor and maintain the same at required interval as per guidelines. Provide proper directional sign. Mid Term Produce proper drawing and plans to create horizontal and vertical fire-rated separation for stairways of appropriate (The remedial works indicated must be specifications, grills, storage and assembly areas, offices, carried out within a period of 6 weeks) work areas. Also design to ensure proper separation of high risk areas (e.g., generator, boiler, transformer and substation rooms) as per guidelines. Produce design drawings to demonstrate how stairways are to be made of adequate dimensions and appropriate specifications and to be converted into fire-rated enclosures equipped with fire-rated side swinging doors of required dimensions opening in the direction of travel at each floor. Produce design to install standard standpipe, hose and fire pump system. Provide design to install proper detection and alarm system. Long Term Install horizontal and vertical fire-rated separation for stairways of appropriate specifications, grills, storage and (The remedial works indicated must be assembly areas, offices, work areas. carried out within a period of 6 months) Ensure proper fire separation of high risk areas (e.g., generator, boiler, transformer and substation rooms) as per approved design. Install fire rated enclosure and doors of appropriate dimensions at exit to the stairs to prevent smoke and fire propagation as per approved design. Install standard standpipe, hose and fire pump system. Install proper detection and alarm system. Provide fire rated enclosure, install self closing fire rated door as per guidelines.

(B): Recommendations for Electrical Safety corrective actions:

Immediate	
(the factory should not continue to be occupied until these non-conformities have been rectified):	

Astro Stich Art Ltd. Last update on Page 2

Summary of Preliminary Assessment on Structural, Fire and Electrical Safety

Short Term (Actions that must be incorporated into a Fire Safety Management Plan immediately (a week) and should be a regular activity	Provide instructions for first aid and artificial respiration from exposure to electrical shock. Ensure well-dressed cabling with lugs and remove loose cabling. Ensure earthing of panel body & door with fitted condition. Provide distribution board as per guideline and put
	identification mark on distribution panel.
Mid Term	Provide separate service ducts for electrical cables.
(The remedial works indicated must be carried out within a period of 6 weeks)	Provide new Emergency Lighting system. Provide appropriate Lightening Protection System as per
	guidelines.
Long Term	
(The remedial works indicated must be carried out within a period of 6 months)	N/A

Astro Stich Art Ltd. Last update on Page 3